



TASKalfa 3501i / 4501i / 5501i

TASKalfa 3051ci / 3551ci / 4551ci / 5551ci

Product Library v.1.1EUR

Release Notes

July 1st, 2013

DVD Contents

Printer Drivers	Version	Windows 2000 Windows Server 2000	Windows XP	Windows Vista Windows 7	Windows Server 2003	Windows Server 2008 Server 2008 R2	Windows 8	Windows Server 2012
KX DRIVER (Generic)	5.1.1405e2	✓						
KX DRIVER	6.0.2611		✓	✓	✓	✓	✓	✓
KX (XPS) DRIVER	1.3.2518			✓		✓	✓	✓
PCL Mini Driver (Generic)	4.1	✓						
PCL Mini Driver	1.1		✓	✓	✓	✓	✓	✓
KPDL Mini Driver (Generic)	8.1112 [12-15-2011]	✓						
KPDL Mini Driver	8.1301 [01-29-2013] (color) 8.1301 [01-29-2013] (mono)		✓	✓	✓	✓	✓	✓
Novell NDPS	6.0.2611	✓	✓*					

FAX and	Version	Windows	Windows	Windows	Windows	Windows	Windows
---------	---------	---------	---------	---------	---------	---------	---------

Scanner Drivers		XP	Vista Windows 7	Server 2003	Server 2008 Server 2008 R2	8	Server 2012
TWAIN Driver	2.0.2308	✓	✓	✓	✓	✓	✓
WIA Driver	2.0.2313 (Network)		✓		✓	✓	✓
FAX Driver	3.9.1411	✓	✓	✓	✓	✓	✓

Utilities	Version	Windows XP	Windows Vista Windows 7	Windows Server 2003	Windows Server 2008 Server 2008 R2	Windows 8	Windows Server 2012
KYOCERA Net Viewer**	5.3.6306	✓	✓	✓	✓	✓	✓
KYOCERA Net Direct Print	2.4.2426	✓	✓	✓	✓	✓	✓
Quick Network Setup	2.0.7	✓*	✓	✓*		✓	
File Management Utility	3.0.1328	✓	✓	✓	✓	✓	✓

(*) Supports 32-bit version of Windows operating systems only.

(**) Does not support local connection.

- For **Mac OS X 10.4**, install PPD Driver version 8.1204 [04-11-2012].
- For **Mac OS X 10.5** or higher, install PPD Driver version 8.1301 [01-28-2013] (color).
- For **Mac OS X 10.5** or higher, install PPD Driver version 8.1301 [01-28-2013] (mono).

Note: Mac OS X drivers are located in the **\Mac OS X** folder. Please follow the instructions in the README file to unpack and install the drivers.

- For **Linux**, install PPD Driver version 8.1301 [1-29-2013].

Note: Linux PPDs are located in the **\Linux** folder. Please follow the instructions in the ReadMe.htm file in this folder to install the PPD files.

- Driver Info is located in the \Utility\ folder on the DVD.

Windows 2000

Install generic printer drivers with the **Add Printer** wizard.

1. Click **Start** in the Windows taskbar.
2. Click **Settings**.
3. Click **Printers**.
4. Click **Add a printer** in the **Printer Tasks** group box on the left.
5. The **Add a Printer** wizard page appears. Click **Next** and follow the instructions.

6. Browse through the DVD to locate the appropriate Oemsetup.inf file.

7. When the **Completing the Add Printer Wizard** page appears, click **Finish**.

Driver Type	Windows 2000 location on DVD
KX DRIVER	\PrnDrv\KXDriver\32bit\Legacy OS\2000
PCL Mini Driver	\PrnDrv\PCL 5 UniDriver\Legacy OS\2000
KPDL Mini Driver	\PrnDrv\KPDL Mini-driver\Legacy OS\2000\language

- Kyocera generic printer drivers do not support the Post Installer.

Documentation on this DVD

- We recommend Adobe® Reader® 8.0 or later to read the PDF documentation. Earlier versions might not display the content correctly.

Document	Location	Supported languages
this file (readme.html)	\Document\readme	English
Operation Guide	\Document \OperationGuide	English, French, German, Italian, Spanish, Japanese Catalan, Portuguese, Czech, Danish, Finnish, Greek Hungarian, Dutch, Norwegian, Polish, Romanian Russian, Swedish, Turkish, Arabic
FAX Operation Guide	\Document \OperationGuide	English, French, German, Italian, Spanish, Japanese
Card Authentication Kit (B) Operation Guide	\Document	English, Japanese
Kyocera Command Center RX User Guide	\Document	English, Japanese
KYOCERA Net Direct Print User Guide	\Document	English, Japanese
Data Security Kit (E) Operation Guide	\Document	English, Japanese
PRESCRIBE Commands Command Reference	\Document	English, Japanese
PRESCRIBE Commands Technical Reference	\Document	English, Japanese
Printer Driver User Guide monochrome / colour	\Document	English, Japanese
File Management Utility User Guide	\Document	English, Japanese

KYOCERA Net Viewer 5.3 User Guide	Document	English, Japanese
--------------------------------------	----------	-------------------

Known Issues:

All Windows Operating Systems

The DVD menu may not launch properly if the Windows operating system is not updated with the latest service packs and critical updates.

Solution: Update the Windows operating system with the latest service packs.

KYOCERA Net Viewer may not install correctly on PCs using Microsoft Windows Installer before 3.1 v2.

Solution: Update to the latest service pack and install the latest Microsoft Windows Installer.

When updating a utility using the DVD Software Installer, the utility installed incorrectly. This is a known issue with the Microsoft Windows Installer.

Solution: Uninstall the previous version of the utility before installing the new one.

If the KX DRIVER is uninstalled immediately after installation, the uninstallation fails.

Solution: Restart the PC and uninstall the KX DRIVER.

Status Monitor is not available from the client side in a server-client environment on Microsoft Windows Server 2003 and 2008.

Adobe® Reader® 8.0 or later is required to read the PDF documentation.

The color of characters printed larger than 72 point differs from smaller characters when "Download as bitmaps" is selected in Font Settings.

Solution: Change the font setting in the Imaging tab of Printing Preferences to "Download as outline".

Some versions of Internet Explorer display the following warning when the Readme file is opened from the DVD.

Active content can harm your computer or disclose personal information. Are you sure that you want to allow DVDs to run active content on your computer?

Solution: Click Yes to open the file. The Readme file is pure html without active content, but some versions of Internet Explorer display a warning for any html document that is launched from an external drive.

A FAX number can only be registered with numerals (0,1,2...) and the following characters: " * " (asterisk) , " – " (dash), " # " (pound sign), or a " " (space).

On Windows Terminal Server and Cluster Server, features normally installed by Optional Components Wizard are not available. This affects Output to PDF, Color Optimizer, Security Watermark, Common Profiles and other extended Driver functions.

When printing from a 32bit application running on a 64bit Windows operating system with Job Accounting enabled, no account codes are sent to the print device and the device displays an "Invalid Account Code" error message.

Solution: Enable the "Print directly to the printer" option in the Advanced tab of Printer Properties, or use a 64bit version of the application.

Notes for Status Monitor's print complete notification

Status Monitor does not display the "Printing completed" notification when a device is sleeping. This notification also does not display for large print jobs that take longer to spool, because Status Monitor automatically closes after a few seconds.

The last "Printing completed" notification may still be displayed at the start of a new session when the above situation occurs.

The device memory light blinks when a device error such as "Add paper" occurs, after the "Printing completed" notification is displayed in Status Monitor. Status Monitor is retrieving the device's status, so the blinking light is not an error.

Windows XP / Vista / Windows 7

Although a user has administration privileges on a machine, the user may not have admin privileges for a printer running on that machine.

Solution: Run the driver in administrator mode by choosing "Run as Administrator".

Windows XP / Vista / Windows 7 / Windows 8, KX DRIVER Only

EMF (enhanced metafile) spooling is not supported for KPDL printing.

An extra blank page prints when a Microsoft Word 2007 document is printed when both mixed paper sizes and Duplex is selected. This is a known limitation in Word 2007.

Some objects in PowerPoint 2007 do not print in Poster mode for 3x3 pages or more. This is a known limitation in PowerPoint 2007.

In Vista and Windows 7, Custom Paper Size is missing from the Paper Size list of Windows Photo Gallery/Photo Viewer. This is a known limitation in the Photo Printing Wizard (PPW) application.

Interactive services dialog detection messages pop-up when printing mixed sized documents in booklet mode on the 64-bit version of Vista.

When adding a 32-bit driver to a shared printer on a server running a 64-bit version of Windows, the model name may appear multiple times in *Share this Printer*.

Solution: To avoid displaying multiple model names, choose "Have Disk" when using the "Additional Drivers..." option and browse to the x86 driver INF file for the desired model to install it.

KPDL pass through mode fails for some Adobe products. This is a known limitation in Adobe products on Vista and Windows 7.

The ICM profile is not installed automatically.

Solution: If your specific color printing needs require the ICM profile, please install it manually using Properties --> Color Management --> Add... .

When printing from 64-bit Adobe applications such as Acrobat Reader in KPDLPass through mode, watermarks will not print.

Application-based printing is not supported on 64-bit versions of Windows.

Smart duplex printing is not supported in booklet mode.

Print Preview is not supported for KPDLPass through mode with applications like Adobe Acrobat.

The following advanced driver settings will not be displayed on the Print Preview: outer n-up borders, poster assembly marks, 180-degree rotation, color adjustment, gutter, EcoPrint, Prologue/Epilogue, Index tab dividers

A blank page is printed when printing multiple complex pages with Print Preview, GDI compatible mode, and 16-up and higher selected at the same time.

Solution: Turn off Print Preview to print correctly.

“Interactive Services” dialog displays in some cases with Print Preview, such as manual duplex in Vista.

While Print Preview dialog is active for one document, all other open documents of the same application cannot be accessed. This is a known limitation in Windows.

Solution: Close the Print Preview dialog to access the other open documents.

Grid lines may appear on some images in Print Preview because of moiré effects. However it will not affect the output.

KPDLPass-through mode does not work when PDL is changed from within an application.

Solution: Close the application, change the PDL mode in the Device Settings tab, then reopen the application.

Lower panel will not be displayed when Y screen resolution is less than 864.

The location for setting paper size has been changed in KX DRIVER 6.0.

Solution: Paper size can now be accessed from “Print size:”->“Custom...”

On a 64-bit Windows OS, Smart Duplex printing may not work with some 32-bit applications, including Microsoft Word and Excel.

Solution: Install the 64-bit version of the application to use Smart Duplex printing on your 64-bit OS.

On a 64-bit Windows OS, the Microsoft Outlook policy in Active Directory and Policy Manager does not take effect for Microsoft Outlook (32-bit).

Solution: Install the 64-bit version of Microsoft Outlook for the policy to take effect on your 64-bit OS.

In the 32-bit version of Windows 8, Application-based Profiles are not supported for

Microsoft Word and Microsoft Excel. This is due to architectural changes in Windows 8.

In Microsoft Word, when shift image option is used with Index tab dividers, image may shift an extra 5mm from original setting.

Solution: Turn off option to scale content for A4 or 8.5 x 11" paper sizes in Microsoft Word.

Application-based printing doesn't work for Microsoft Outlook 2010.

Solution: Open Microsoft Outlook 2010's print option two times.

Index tab dividers cannot be used with duplex, cover mode and page insert's print onto front and print onto back combination settings.

Solution: Insert page for index tab dividers cannot be same as cover mode and page insert.

Windows Vista / Windows 7, KPDL and PCL Mini-drivers Only

Some KPDL mini-driver features may be selected without the associated peripheral device attached to the printer.

Solution: Verify that the associated peripheral device is attached to the printer before using the feature.

If any of the Device Settings are manually changed in Printer Properties/Device Settings, Auto Configure support will be deactivated for those changed settings until the system is rebooted.

Solution: To activate the Auto Configure support again, reboot the system. If rebooting is not an option, reinstall the driver and wait several minutes for the Auto Configure to begin.

For the PCL mini-drivers, the paper size "User Defined Size" may appear in some applications as an option. Selecting this paper size will cause the printer to use a default size, such as Letter/A4.

Solution: Ignore this entry. If a custom size is needed, add a Custom Form on the Printer Server Properties dialog box.

Auto-configuration for Printer Memory may not function for some printers with on-board network cards.

Solution: Set the value in Printer Properties manually.

The "Automatically Select" option may not select the proper paper source with the matching size when documents are being printed.

Solution: This is an operating system limitation. Please select the exact paper source you want in Document Properties, or choose the "Auto" option under paper source.

USB connected print devices are unable to enter standby and log 0 page jobs.

Solution: Disable bidirectional support in the Ports tab of the Printer Properties window.

Windows Vista / Windows 7, KX (XPS) DRIVER Only

Some advanced XPS features are not available when printing from GDI-based applications such as Office 2007. These are known limitations of the Microsoft XPS Document Writer (MSDW).

Kyocera driver plug-ins, such as Security Watermark and Output to PDF, are not supported by the KX (XPS) DRIVER.

The Prologue/Epilogue feature is not supported.

This driver supports only XPS supported printer hardware. It will not work with KPDL, PCL XL, or PCL 5.

Because of a file limitation in the XPS container, printing hundreds of copies of a multi-page print job might result in an invalid XPS file.

Solution: Split the copies into multiple print jobs.

When mixed paper size document is printed with N-up, the output paper size is incorrect.

Additional white space prints at the bottom of a page when printing multiple pages per sheet with Gutter enabled.

KX (XPS) DRIVER did not upgrade.

Solution: Uninstall the earlier KX (XPS) DRIVER and install the KX (XPS) DRIVER.